

Evita 2 dura

Technical Service Bulletin # 16

Re: New software version 3.21

Update: May 24, 2000

Reference Doc: IDM no. 16 / 09.99

Reason: Product improvement. This software version 3.21 replaces all older versions in the USA and Canada.
These are the most important changes if the device is upgraded to software version 3.21:

- The option NeoFlow is possible.
- Remove of the following software error:
The activation or end of the nebulizer function can impede spontaneous breathing during an expiration cycle in the pediatric mode. In this situation flow will not be delivered to support spontaneous breathing until the next mandatory or pressure support breath is delivered. As long as nebulization is activated, some spontaneous breathing is allowed by the nebulizer flow.

Solution: Installation of new software version SW 3.21.

Devices affected: Recommended for all Evita 2 dura units with older software versions.

When: When requested by Customer, next Service Call or Preventive Maintenance.

Additional Info: After downloading the new software, perform a device check in stand-by. The message "Loss of data" may occur shortly after first power on after this download and is not a device malfunction. The message will disappear after the internal data backup is completed.

Cost: Covered by Customer.

Ordering Info: Evita 2 dura software version 3.21 upgrade kit P/N 84 14 585
The kit consists of Operating Instructions, option label, and disk with SW 3.21.

Distribution: Dräger Service Personnel and Authorized Service Organizations for CCS products.

If you have any questions, please contact Technical Support by phone at 1-800-543-5047 or by fax at 1-215-721-5789

Dräger Medical, Inc.
Technical Product Manager